




A San Diego County Water Analysis Provider

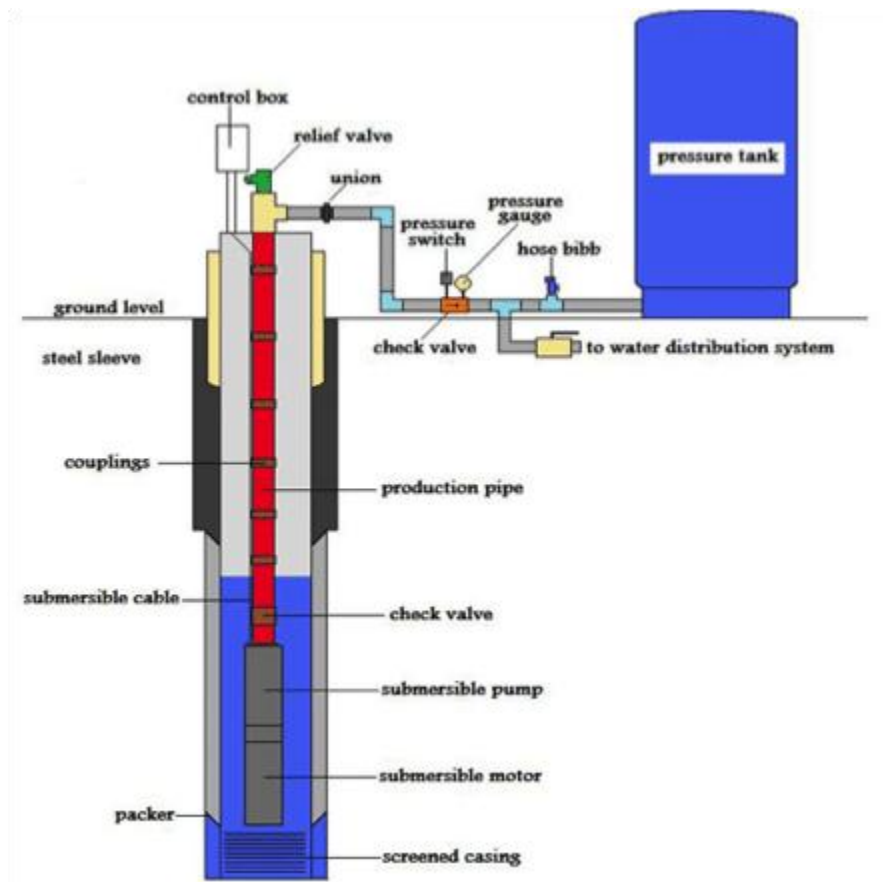

Well Water Analysis Report

Thank you for your business and confidence in Oasis Utility Services! On August 24th 2026, well water collection and analysis was conducted at the address of 20899 Black Canyon Road in Ramona, California. Attached are the laboratory findings and Chain-of-Custody record. These findings were not recorded to any regulatory database. These findings will indicate the well water quality at the time and date of collection. Natural or man-made events occurring subsequent to these findings may affect the well water quality. Notable observations and conclusions from these findings are as follows:

1. The water sampled does meet the private well testing basic requirements for Potable Water as defined by the EPA.
2. The water sampled does not exceed the EPA limit for Nitrate (10.0 mg/l) at 2.12 mg/l.
3. The water sampled does not contain Coliform Bacteria.
4. The water sampled does not contain E.Coli Bacteria.
5. Free-Chlorine levels were measured at 0.0 ppm.

Sample Notes:

Location: Well # 1 via Reverse Osmosis Tap

Distribution system status while tested: Intact

Sourcing To: Dwellings and Landscape

Filtration Notes:

Water treatment / filtration is present on this distribution system:

1. 5 Stage Reverse Osmosis filtration (78% Efficient)
2. Single Stage Sediment Filter

Water Quality Observations:

All measurements above EPA acceptable limits (MCLs & MCLGs) are marked in red.

Ph level : 7.6 (Slightly Alkaline, relative to 7 Ph)

Total Dissolved Solids (TDS) : 95ppm (EPA Guideline MCL <500ppm)

Electrical Conductivity (EC) : 211uS/cm (Relative to a drinking water target of <1500 uS/cm)

Hardness : 5ppm (Minimal Hardness, Relative to a general definition of hard water as >200ppm)

Lead : 0.0ppb (MCL Limit 15ppb)

Total Chlorine : 0.0ppm

Total Alkalinity : 30ppm

Carbonate : 60ppm

Hydrogen Sulfate : <0.1ppm

Iron : 0.0ppm

Copper : <0.1ppm

Manganese : <0.01ppm

Mercury : 0.0ppm

Zinc : 0.0ppm
Fluoride : 0.0ppm
Sodium Chloride : 10ppm
Sodium as %: 0.0
General Turbidity at Wellhead: Clear

Course of Action:

1. *It is always recommended drinking water be sourced from a Reverse Osmosis filtration system. This filtration method will ensure a potable water supply through variable well water conditions and potential contaminates.*
2. *Immediately update well water analysis if a pregnant person, infant, or individual with a compromised immune system will begin consuming a well water supply.*
3. *Continue annual EPA water analysis.*
4. *It is recommended all repairs be completed by a reputable and licensed C57 contractor; **Contact Southern California Well Service 760-440-8520, for any well equipment needs or repairs.***

Respectfully Prepared By:



OasisUtilityServices.com
760-496-4882
Box 811
Julian, CA 92036