




A San Diego County Water Analysis Provider

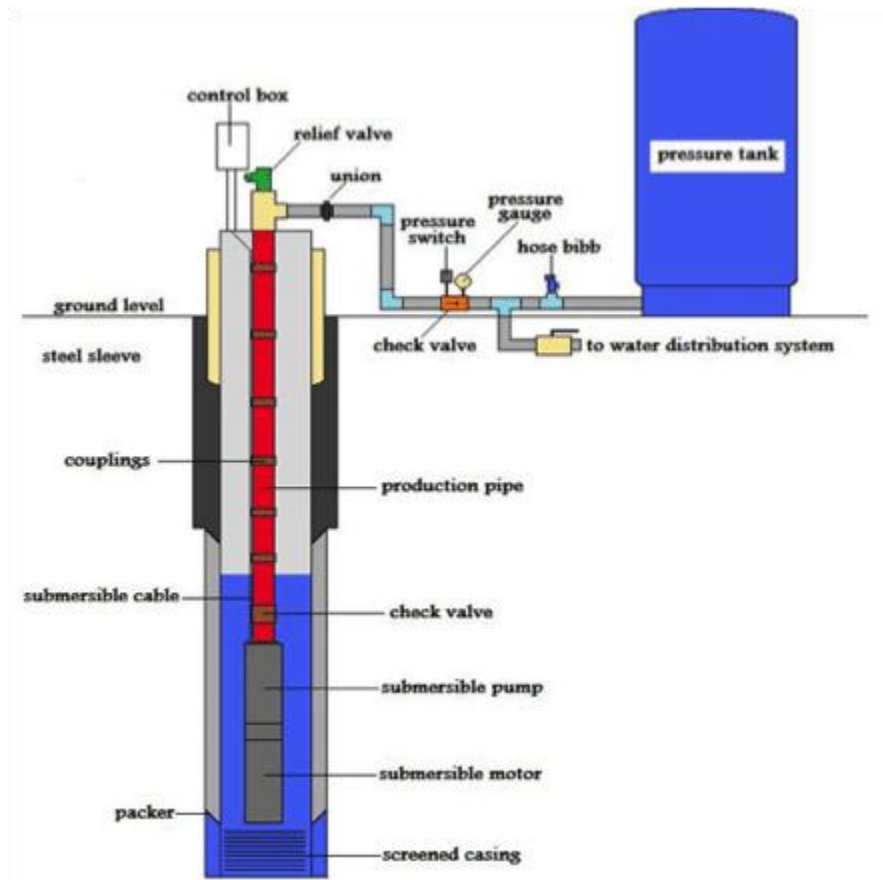

Well Water Analysis Report

Thank you for your business and confidence in Oasis Utility Services! On July 22nd 2026, well water collection and analysis was conducted at the address of 20899 Black Canyon Road in Ramona, California. Attached are the laboratory findings and Chain-of-Custody record. These findings were not recorded to any regulatory database. These findings will indicate the well water quality at the time and date of collection. Natural or man-made events occurring subsequent to these findings may affect the well water quality. Notable observations and conclusions from these findings are as follows:

1. The water sampled currently does not meet the private well testing basic requirements for Potable Water as defined by the EPA.
2. The water sampled **does** exceed the EPA limit for Nitrate (10.0 mg/l) at [t] mg/l.
3. The water sampled does not contain Coliform Bacteria.
4. The water sampled does not contain E.Coli Bacteria.
5. Free-Chlorine levels were measured at 0.0 ppm.

Sample Notes:

Location: Well # 1 via Kitchen Tap

Distribution system status while tested: Intact

Sourcing To: Dwellings and Landscape

Filtration Notes:

Water treatment / filtration is present on this distribution system:

1. Single Stage Sediment Filter

Water Quality Observations:

All measurements above EPA acceptable limits (MCLs & MCLGs) are marked in red.

Ph level : 7.1 (Slightly Alkaline, relative to 7 Ph)

Total Dissolved Solids (TDS) : 930ppm (EPA Guideline MCL <500ppm)

Electrical Conductivity (EC) : 462uS/cm (Relative to a drinking water target of <1500 uS/cm)

Hardness : 40ppm (Minor Hardness, Relative to a general definition of hard water as >200ppm)

Lead : 0.0ppb (MCL Limit 15ppb)

Total Chlorine : 0.0ppm

Total Alkalinity : 130ppm

Carbonate : 120ppm

Hydrogen Sulfate : <0.1ppm

Iron : <1ppm

Copper : <0.1ppm

Manganese : <0.01ppm

Mercury : 0.0ppm

Zinc : 0.0ppm

Fluoride : 0.0ppm

Sodium Chloride : 125ppm

Sodium as %: 0.04

General Turbidity at Wellhead: Clear

Course of Action:

1. *Please review the EPA's guidelines on water containing nitrates. This is a common well water condition and can be easily corrected. Any drinking water sourced from this well will need to be adequately filtered. Pregnant women and infants are most sensitive to nitrates and must not drink from this water source without proper filtration in place. Boiling this water will not remove nitrates.*
2. *Water filtration needed. Recommending the installation of a drinking water filtration system targeting nitrates and bacteria, such as Reverse Osmosis. This filtration method will ensure a potable water supply through variable well water conditions and potential contaminates.*
3. *Immediately update well water analysis if a pregnant person, infant, or individual with a compromised immune system will begin consuming a well water supply.*
4. *Continue annual EPA water analysis.*
5. *It is recommended all repairs be completed by a reputable and licensed C57 contractor; **Contact Southern California Well Service 760-440-8520**, for any well equipment needs or repairs.*

Respectfully Prepared By:



OasisUtilityServices.com

760-496-4882

Box 811

Julian, CA 92036